

Application Guide



Tankguard 412

Product description

This is a two component solvent free polyamine cured epoxy coating. It is a general purpose tank lining with good chemical resistance. Can be used as primer, mid coat or finish coat in atmospheric and immersed environments. Suitable for properly prepared carbon steel, galvanised steel, stainless steel and concrete substrates.

Scope

The Application Guide offers product details and recommended practices for the use of the product.

The data and information provided are not definite requirements. They are guidelines to assist with efficient and safe use, and optimum service of the product. Adherence to the guidelines does not relieve the applicator of responsibility for ensuring that the work meets specification requirements. Jotun's liability is in accordance with general product liability rules.

The Application Guide (AG) must be read in conjunction with the relevant specification, Technical Data Sheet (TDS) and Safety Data Sheet (SDS) for all the products used as part of the coating system.

Referred standards

Reference is generally made to ISO Standards. When using standards from other regions it is recommended to reference only one corresponding standard for the substrate being treated.

Surface preparation

The required quality of surface preparation can vary depending on the area of use, expected durability and if applicable, project specification.

When preparing new surfaces, maintaining already coated surfaces or aged coatings it is necessary to remove all contamination that can interfere with coating adhesion, and prepare a sound substrate for the subsequent product.

Inspect the surface for hydrocarbon and other contamination and if present, remove with an alkaline detergent. Agitate the surface to activate the cleaner and before it dries, wash the treated area using fresh water.

Process sequence

Surface preparation and coating should normally be commenced only after all welding, degreasing, removal of sharp edges, weld spatter and treatment of welds is complete. It is important that all hot work is completed before coating commences.

Soluble salts removal

Soluble salts have a negative impact on the coating systems performance, especially when immersed. Jotun's general recommendations for maximum soluble salts (sampled and measured as per ISO 8502-6 and -9) content on a surface are:

Potable water tanks: 50 mg/m²

Chemical tanks: 50 mg/m²

Carbon steel

Initial rust grade

The steel shall preferably be Rust Grade A or B (ISO 8501-1). It is technically possible to apply the coating to rust grades C and D, but it is practically challenging to ensure specified film thickness on such a rough surface, hence risk of reduced lifetime of the coating system. When steel of Rust Grade C or D is coated, the frequency of inspection and testing should be increased.

Application Guide

Tankguard 412



Metal finishing

All edges shall have a rounded radius of minimum 2 mm subjected to three pass grinding or equally effective method.

Pitting repair

Pittings in steel can be difficult to cover fully with most coatings. In some areas it is practically feasible to use filler to fill pittings. This should then be done either after the initial surface preparation or after application of first coat.

Abrasive blast cleaning

Cleanliness

After pre-treatment is complete, the surface shall be dry abrasive blast cleaned to Sa 2½ (ISO 8501-1) using abrasive media suitable to achieve a sharp and angular surface profile.

Surface profile

Recommended surface profile 50-100 µm, grade Medium to Coarse G (ISO 8503-2). Measure the achieved profile with surface replication tape (Testex) to ISO 8503-5 or by a surface roughness stylus instrument (ISO 8503-4).

Abrasive media quality

The mineral abrasive may be of any material that meets the specified requirements. It shall be composed of clean, sound, hard particles free from foreign substances such as dirt, oil, grease, toxic substances, paint, organic matter and water soluble salts. (According to ISO 11125 and ISO 11126). The moisture content for material delivered shall not exceed 0.5% (by weight) and the conductivity when tested according to ISO 11127-7 shall not exceed 250 µS/cm.

Compressed air quality

The supply of clean air to blasting pots must be secured to avoid contamination of abrasive and thereby of blast cleaned surfaces. Compressors must be fitted with sufficient traps for oil and water. It is also recommended to fit two water separators at the blasting machine to ensure a supply of moisture-free air to the abrasive chamber.

Dust contamination

On completion of abrasive blasting, the prepared surface shall be vacuum cleaned to remove residues of corrosion products and abrasive media, and inspected for particulate contamination. Maximum dust quantity rating 1 (ISO 8502-3). Dust size no greater than class 2. Continue cleaning until testing shows the required result.

Galvanised steel

Abrasive blast cleaning

The surface to be coated shall be dry abrasive blast cleaned as required for the specified surface profile using approved non-metallic abrasive media which is suitable to achieve a sharp and angular surface profile. As a guide, a surface profile corresponding to 25-55 µm, grade Fine G; Ry5 (ISO 8503-2) should be achieved.

Stainless steel

Abrasive blast cleaning

The surface to be coated shall be dry abrasive blast cleaned as required for the specified surface profile using non-metallic abrasive media which is suitable to achieve a sharp and angular surface profile. As a guide, a surface profile corresponding to 25-55 µm, grade Fine G; Ry5 (ISO 8503-2) should be achieved.

Chlorinated or chlorine containing solvents or detergents must not be used on stainless steel.

Concrete

Application Guide

Tankguard 412



Concrete should be a minimum of 28 days old, applying any coating before this time will greatly increase the chance of the coating de-bonding. The moisture content of the concrete should be checked prior to the application of the coating and should not be greater than 5%. Concrete substrates should be mechanically prepared to leave a clean, sound and dry base on which a coating system can be applied.

Clean – Free of oils, grease, dust, dirt, chemicals, loose coating, curing compounds, form release oils, sealers or hardeners must be removed prior to coating.

Sound – Concrete that has unsound areas (voids, hollow spots, and friable surface) may have to be removed, replaced or repaired with materials that are compatible with the selected coating system.

Dry – It is important to address dryness because most coatings require a dry surface for proper adhesion. Moisture contained within the concrete that moves towards the surface through the pores of the concrete may prevent adequate coating adhesion.

Dry abrasive blast cleaning to SSPC-SP 13/NACE No. 6. Where the concrete has become contaminated with oils, grease, or fuels, water emulsifiable degreasers-cleaners may be used to remove these contaminants. It is important to only clean an area that can be fully washed down after degreasing before any of the cleaner can dry on the surface. Ultra high pressure water jetting can be used to remove laitance and reveal blowholes and imperfections. Ensure concrete is dry before coating application.

Sand sweeping

Dry abrasive blast cleaning to SSPC-SP 13/NACE No. 6. All prepared surfaces should then have all “blow holes” and other surface defects filled with suitable filler that is compatible with the primer and finish coat system to ensure that the coating can be applied over a smooth and regular substrate.

Diamond disc grinding

Diamond grind the surface to remove all laitance and expose the aggregates.

Water cleaning

Low pressure water washing to a rough, clean, dry and laitance free surface.

Coated surfaces

Shop primers

Shop primers are accepted as temporary protection of steel plates and profiles. However the shopprimer should be completely removed through blast cleaning to minimum Sa 2½ (ISO 8501-1) using abrasive media suitable to achieve a sharp and angular surface profile 50-100 µm, grade Medium G; Ry5 (ISO 8503- 2).

Application

Acceptable environmental conditions - before and during application

Before application, test the atmospheric conditions in the vicinity of the substrate for the dew formation according to ISO 8502-4.

Air temperature	10 - 50	°C
Substrate temperature	10 - 60	°C
Relative Humidity (RH)	10 - 60	%

The following restrictions must be observed:

- Only apply the coating when the substrate temperature is at least 3 °C (5 °F) above the dew point
- Do not apply the coating if the substrate is wet or likely to become wet

Product mixing

Application Guide

Tankguard 412



Product mixing ratio (by volume)

Tankguard 412 Comp A	2 part(s)
Tankguard 412 Comp B	1 part(s)

Induction time and Pot life

Paint temperature **23 °C**

Induction time	10 min
Pot life	1 h

The temperature of base and curing agent is recommended to be 18 °C or higher when the product is mixed.

Thinner/Cleaning solvent

Prior to application in potable water tanks flush the application equipment with Jotun Thinner No. 28. Use Jotun Thinner No. 17 for cleaning equipment after application.

Application data

Spray application

Airless Spray Equipment

Pump ratio (minimum) :	64:1
Pressure at nozzle (minimum) :	175 bar/2500 psi
Nozzle tip (inch/1000) :	19-25
Nozzle output (litres/minute) :	1.5-2.6
Filters (mesh) :	50-70

Several factors influence, and need to be observed to maintain the recommended pressure at the nozzle. Among factors causing pressure drop are:

- extended hoses or hose bundles
- extended hose whip-end line
- small internal diameter hoses
- high paint viscosity
- large spray nozzle size
- inadequate air capacity from compressor
- incorrect or clogged filters

Other application tools

Brush application

Suitable for application by brush. Recommended for first coat or stripe coating application in corners, on edges and other areas difficult to reach. A stiff brush is recommended. It will be necessary to apply additional coats to achieve a similar dry film thickness as when the coating is applied by airless spray.

Roller application

Suitable for application by roller. The addition of a small volume of thinner is recommended to achieve improved flow. In tanks roller is recommended for scallops and rat holes only.

Application Guide

Tankguard 412



Film thickness per coat

Typical recommended specification range

Dry film thickness	150 - 500	µm
Wet film thickness	150 - 500	µm
Theoretical spreading rate	6.5 - 2	m ² /l

Can on horizontal areas be applied up to 1000 µm.

This product can be applied up to 50 % higher than maximum specified film thickness without loss of technical properties.

Film thickness measurement

Wet film thickness (WFT) measurement and calculation

To ensure correct film thickness, it is recommended to measure the wet film thickness continuously during application using a painter's wet film comb (ISO 2808 Method 1A). The measurements should be done as soon as possible after application.

Fast drying paints may give incorrect (too low) readings resulting in excessive dry film thickness. For multi layer physically drying (resoluble) coating systems the wet film thickness comb may give too high readings resulting in too low dry film thickness of the intermediate and top coats.

Use a wet-to-dry film calculation table (available on the Jotun Web site) to calculate the required wet film thickness per coat.

Dry film thickness (DFT) measurement

When the coating has cured to hard dry state the dry film thickness can be checked to SSPC PA 2 or equivalent standard using statistical sampling to verify the actual dry film thickness. Measurement and control of the WFT and DFT on welds is done by measuring adjacent to and no further than 15 cm from the weld.

Application / Drying / Curing considerations

Pay close attention to both spraying technique and the correct setting of equipment during application in order to achieve an even, pinhole free film. A combination of the correct inbound air / outbound material pressure, correct airless tip or spray set up and a 30-50 cm gun to substrate distance is recommended. Apply the coating in even and uniform parallel passes and overlap each pass 50% to achieve an even film. Use a painter's wet film comb during application to control the wet to dry film thickness of the coating.

Ventilation

As a guideline for good ventilation, after application of each coat the confined space should be ventilated corresponding to minimum 3 exchanges of air per hour. After final coat maintain minimum 3 exchanges of air per hour for at least 48 hours. Thereafter the number of air exchanges can be reduced to 1 per hour until the coating is dried/cured for service.

For more detailed information reference is made to Jotun's General Tank Coating Code of Practice.

Stripe coating

The stripe coat sequence can be either of the following:

1. Surface preparation, full coat, stripe coat. This sequence can be used when a large substrate area has been prepared and leaving the substrate exposed for a long time while doing stripe coating could lead to surface deterioration.
2. Surface preparation, stripe coat, full coat.

In general Jotun recommends alternative 1 because it reduces the risk that "new" contamination will be introduced to the uncoated substrate.

Application Guide

Tankguard 412



Walking on the blast cleaned substrate in order to do the stripe coating presents a risk for such contamination.

It is important to pay special attention to edges, openings, rear sides of stiffeners, scallops etc. and to apply a stripe coat to these areas where the spray fan may not reach or deposit an even film.

When applying a stripe coat to bare metal use only a stiff, round stripe coating brush to ensure surface wetting and filling of pits in the surface.

Stripe coating shall be of a different colour to the main primer coat and the topcoat colour and should be applied in an even film thickness, avoiding excessive brush marks in order to avoid entrapped air. Care should be taken to avoid excessive film thickness. Pay additional attention to pot life during application of stripe coats.

Jotun recommends a minimum of one stripe coat. A second stripe coat will be beneficial in order to ensure that sufficient paint material is applied to the critical parts of the object.

Coating loss

The consumption of paint should be controlled carefully, with thorough planning and a practical approach to reducing loss. Application of liquid coatings will result in some material loss. Understanding the ways that coating can be lost during the application process, and making appropriate changes, can help reducing material loss.

Some of the factors that can influence the loss of coating material are:

- type of spray gun/unit used
- air pressure used for airless pump or for atomization
- orifice size of the spray tip or nozzle
- fan width of the spray tip or nozzle
- the amount of thinner added
- the distance between spray gun and substrate
- the profile or surface roughness of the substrate. Higher profiles will lead to a higher "dead volume"
- the shape of the substrate target
- environmental conditions such as wind and air temperature

Drying and Curing time

Substrate temperature	10 °C	23 °C	40 °C
Surface (touch) dry	15 h	6 h	1.5 h
Walk-on-dry	30 h	12 h	4 h
Dry to over coat, minimum	30 h	12 h	4 h
Dried/cured for service	15 d	7 d	4 d

Drying and curing times are determined under controlled temperatures and relative humidity below 60 %, and at average of the DFT range for the product.

Surface (touch) dry: The state of drying when slight pressure with a finger does not leave an imprint or reveal tackiness.

Walk-on-dry: Minimum time before the coating can tolerate normal foot traffic without permanent marks, imprints or other physical damage.

Dry to over coat, minimum: The recommended shortest time before the next coat can be applied.

Dried/cured for service: Minimum time before the coating can be permanently exposed to the intended environment/medium.

Application Guide

Tankguard 412



Maximum over coating intervals

Maximum time before thorough surface preparation is required. The surface must be clean and dry and suitable for over coating. Inspect the surface for chalking and other contamination and if present, remove with an alkaline detergent. Agitate the surface to activate the cleaner and before it dries, wash the treated area by low-pressure water jetting to Wa 1 (ISO 8501-4) using fresh water.

If maximum over coating interval is exceeded the surface should in addition be carefully roughened to ensure good inter coat adhesion.

Areas for atmospheric exposure

Average temperature during drying/curing	10 °C	23 °C	40 °C
Itself	5 d	5 d	3 d
epoxy	5 d	5 d	3 d
polyurethane	5 d	5 d	3 d

Areas for immersed exposure

Average temperature during drying/curing	10 °C	23 °C	40 °C
Itself	5 d	5 d	3 d
epoxy	5 d	5 d	3 d

Other conditions that can affect drying / curing / over coating

Repair of coating system

Damages to the coating layers:

Prepare the area through sandpapering or grinding, followed by thorough cleaning/vacuuming. When the surface is clean and dry the coating may be over coated by itself or by another product, ref. original specification.

Always observe the maximum over coating intervals. If the maximum over coating interval is exceeded the surface should be carefully roughened in order to ensure good intercoat adhesion.

Damages exposing bare substrate:

Remove all rust, loose paint, grease or other contaminants by spot blasting, mechanical grinding, water and/or solvent washing. Feather edges and roughen the overlap zone of surrounding intact coating. Apply the coating system specified for repair.

Repair of damaged areas

Sags and runs can be caused by too high wet film thickness, too much thinner added or the spray gun used too close to the surface.

Repair by using a paint brush to smooth the film when still wet.

Sand down to a rough, even surface and re-coat if the coating is cured.

Orange peel can be caused by poor flow/levelling properties of the paint, poor atomization of the paint, thinner evaporating too fast or the spray gun held too close to the surface.

This can be rectified by abrading the surface and applying an additional coat after having adjusted the application properties or the application technique.

Dry spray can be caused by poor atomization of the paint, spray gun held too far from the surface, high air temperature, thinner evaporating too fast or coating applied in windy conditions.

Sand down to a rough even surface and re-coat.

Pinholes can be caused by entrapped solvents in the film or by incorrect application technique. Pinholes can be repaired as per procedure for damages to the coating layer or to the substrate, ref. above.

Application Guide

Tankguard 412



Surface finish

Amine sweating may occur when amine cured epoxy coatings are cured at low temperatures and/or humid conditions. Amine sweating can sometimes be observed on the surface as a sticky residue or as discolouration. It can seriously affect the adhesion of the subsequent coat and must be removed. If amine sweating is suspected, wash the surface with warm water and detergent, and rinse thoroughly with water. Light abrasion of the surface and removal of dust before over coating will further secure good intercoat adhesion. Amine sweating can be minimized by observing the induction time stated in TDS.

Coating film continuity

Jotun recommends that all coating systems for immersion shall be inspected for film continuity/defects by visual observation of pin hole rusting through the coating after tank hydro-testing or sea water immersion during sea trials. Alternatively, full immersion of tanks in combination with tanks fully saturated by tank cleaning machine(s), soaking all surfaces with sea water and creating a high condensation environment during sea trials.

All noted defects shall be repaired or reported as outstanding issues.

For onshore storage tanks or for tanks where sea water immersion may not be permitted or practical, coating shall be tested for film continuity/defects as described in ASTM D 5162, method A or B as appropriate for the coating thickness.

The recommended voltage is 500 volts per 100 µm DFT. The acceptance criterion is no defects. Defects found shall be repaired as per coating specification.

Quality assurance

The following information is the minimum required. The specification may have additional requirements.

- Confirm that all welding and other metal work has been completed before commencing pre-treatment and surface preparation
- Confirm that installed ventilation is balanced and has the capacity to deliver and maintain the RAQ
- Confirm that the required surface preparation standard has been achieved and is held prior to coating application
- Confirm that the climatic conditions are within recommendations in the AG, and are held during the application
- Confirm that the required number of stripe coats have been applied
- Confirm that each coat meets the DFT requirements in the specification
- Confirm that the coating has not been adversely affected by rain or other factors during curing
- Observe that adequate coverage has been achieved on corners, crevices, edges and surfaces where the spray gun cannot be positioned so that its spray impinges on the surface at 90° angle
- Observe that the coating is free from defects, discontinuities, insects, abrasive media and other contamination
- Observe that the coating is free from misses, sags, runs, wrinkles, fat edges, mud cracking, blistering, obvious pinholes, excessive dry spray, heavy brush marks and excessive film build
- Observe that the uniformity and colour are satisfactory

All noted defects shall be fully repaired to conform to the coating specification.

Caution

This product is for professional use only. The applicators and operators shall be trained, experienced and have the capability and equipment to mix/stir and apply the coatings correctly and according to Jotun's technical documentation. Applicators and operators shall use appropriate personal protection equipment when using this product. This guideline is given based on the current knowledge of the product. Any suggested deviation to suit the site conditions shall be forwarded to the responsible Jotun representative for approval before commencing the work.

For further advice please contact your local Jotun office.

Health and safety

Please observe the precautionary notices displayed on the container. Use under well ventilated conditions. Do not inhale spray mist. Avoid skin contact. Spillage on the skin should immediately be removed with suitable cleanser, soap and water. Eyes should be well flushed with water and medical attention sought immediately.

Accuracy of information

Application Guide

Tankguard 412



Always refer to and use the current (last issued) version of the TDS, SDS and if available, the AG for this product. Always refer to and use the current (last issued) version of all International and Local Authority Standards referred to in the TDS, AG & SDS for this product.

Colour variation

Some coatings used as the final coat may fade and chalk in time when exposed to sunlight and weathering effects. Coatings designed for high temperature service can undergo colour changes without affecting performance. Some slight colour variation can occur from batch to batch. When long term colour and gloss retention is required, please seek advice from your local Jotun office for assistance in selection of the most suitable top coat for the exposure conditions and durability requirements.

Reference to related documents

The Application Guide (AG) must be read in conjunction with the relevant specification, Technical Data Sheet (TDS) and Safety Data Sheet (SDS) for all the products used as part of the coating system.

When applicable, refer to the separate application procedure for Jotun products that are approved to classification societies such as PSPC, IMO etc.

Symbols and abbreviations

min = minutes

h = hours

d = days

°C = degree Celsius

° = unit of angle

µm = microns = micrometres

g/l = grams per litre

g/kg = grams per kilogram

m²/l = square metres per litre

mg/m² = milligrams per square metre

psi = unit of pressure, pounds/inch²

Bar = unit of pressure

RH = Relative humidity (% RH)

UV = Ultraviolet

DFT = dry film thickness

WFT = wet film thickness

TDS = Technical Data Sheet

AG = Application Guide

SDS = Safety Data Sheet

VOC = Volatile Organic Compound

MCI = Jotun Multi Colour Industry (tinted colour)

RAQ = Required air quantity

PPE = Personal Protective Equipment

EU = European Union

UK = United Kingdom

EPA = Environmental Protection Agency

ISO = International Standards Organisation

ASTM = American Society of Testing and Materials

AS/NZS = Australian/New Zealand Standards

NACE = National Association of Corrosion Engineers

SSPC = The Society for Protective Coatings

PSPC = Performance Standard for Protective Coatings

IMO = International Maritime Organization

ASFP = Association for Specialist Fire Protection

Disclaimer

The information in this document is given to the best of Jotun's knowledge, based on laboratory testing and practical experience. Jotun's products are considered as semi-finished goods and as such, products are often used under conditions beyond Jotun's control. Jotun cannot guarantee anything but the quality of the product itself. Minor product variations may be implemented in order to comply with local requirements. Jotun reserves the right to change the given data without further notice.

Users should always consult Jotun for specific guidance on the general suitability of this product for their needs and specific application practices.

If there is any inconsistency between different language issues of this document, the English (United Kingdom) version will prevail.